

TECHNICAL DATA SHEET FOR LOCKFAST G10

PRODUCT DESCRIPTION

LOCKFAST G10 is designed for the sealing of gaskets. The product is a single component anaerobic, acrylic based product. The product cures when confined in the absence of air between close fitting metal surfaces. It seals close fitting joints between flanges and fixed metal faces and will flex with minor movement from the flange.

LOCKFAST G10 offers the following characteristics:

Technology	Acrylic
Appearance (uncured)	Red
Chemical Form	Methacrylate ester
Fluorescence	Positive under UV
Cure	Anaerobic
Secondary cure	Activator
Components	Single – requires no mixing
Viscosity	High
Application	Sealing
Technology	Acrylic


G10 is used as form-in-place gasket for applications on pumps, compressors, axel covers and transmission housing.

PROPERTIES OF UNCURED MATERIAL

	Typical Value
Specific Gravity @ 25°C	1.1
Viscosity @ 25°C	500,000 mPas
Flash Point	See MSDS
Sealing Time	1-2 hours


CURE SPEED VS. SUBSTRATE

The rate of cure is dependant on substrate used. The graph below shows shear strength developed with time on grit blasted steel lap shears compared to different materials and tested according to ISO 4587.

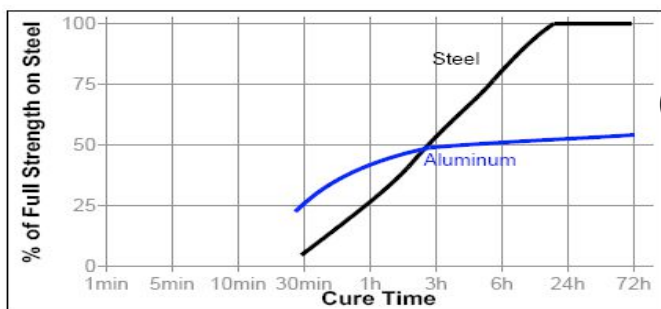


CURE VS. BOND GAP

The rate of cure will depend on the bond gap the graph below shows sheer strength developed on grit blasted steel lap shears compared to different materials & tested according to ISO 4587.

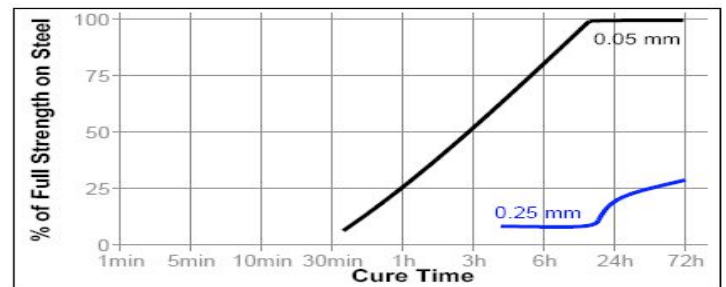

CURE SPEED VS. TEMPERATURE

The rate of cure is dependent on the ambient temperature. The graph below shows the breakaway strength developed with time at different temperatures on grit blasted steel lap shears and tested according to ISO 4587.

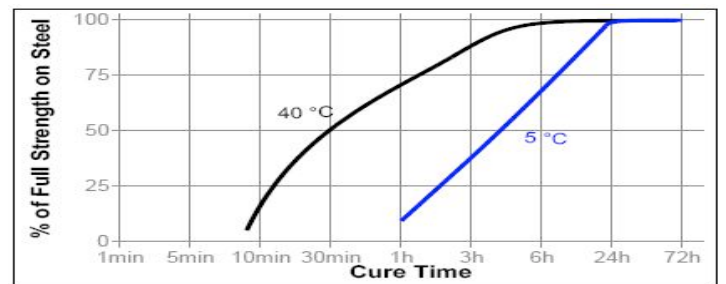

CURE SPEED VS. ACTIVATOR

Where the cure speed is unacceptably long or large gaps are present. An activator can be applied to the surface which will improve cure speed.

TYPICAL PERFORMANCE OF CURED MATERIAL

Operating temp °C -54°C – 200°C

(After 24 hr at 20-25°C) on M10 steel nuts & bolts)

Adhesive Properties	Typical Value
Lap shear strength steel (grit blasted)	
ISO 4587	8Nm

TECHNICAL DATA SHEET FOR LOCKFAST G10

GENERAL INFORMATION

This product is not recommended for use in pure oxygen and/or oxygen rich systems and should not be used with chlorine or other strong oxidising materials.

For information on the safe handling of this product, consult the Material Safety Data Sheet, (MSDS).

Where washing systems are used to clean the surfaces before bonding, it is important to check the compatibility of the washing solution with the adhesive. In some cases these solutions can affect the cure and performance of the adhesive. This product is not recommended for use on certain plastics.

DIRECTIONS FOR USE

1. For optimum performance surfaces should be clean and free of grease.
2. If the material is an inactive metal consider using activator.
3. Shake the product thoroughly before use.
4. Apply several drops to the bolt & nut.
5. Assemble and tighten as required.
6. To prevent the clogging of the nozzle, do not let the tip touch metal surface during application

FOR DISASSEMBLY

1. Remove with standard hand tools.
2. In circumstances where hand tools do not work, use localized heat to bolt or nut, disassemble while hot.

FOR CLEAN UP

1. To remove cured product use a combination of solvent and abrasion such as a wire brush.

PRECAUTION

1. Use proper ventilation, avoid contact with skin and eyes. If contact with skin occurs, rinse with warm water or dissolve gradually with appropriate debonder.
2. Do not try to remove forcibly.
3. If adhesive gets into eye, keep eye open and rinse thoroughly. Seek medical attention immediately.
4. Keep well out of reach of children.

STORAGE

Keep adhesive in a cool, dry place optimal storage 8°C-21°C, is recommended unless otherwise labelled. To prevent contamination of unused material, do not return any product to its original container. For specific shelf life information, contact Cyanotec Ltd.

Disclaimer: The data contained herein are furnished for information purposes only and are believed to be reliable. However, Cyanotec Ltd does not assume responsibility for any results obtained by persons over whose methods Cyanotec Ltd has no control. It is the user's responsibility to determine the suitability of Cyanotec Ltd products or any production methods mentioned herein for a particular purpose, and to adopt such precautions as may be advisable for the protection of property and persons against any hazards that may be involved in the handling and use of any Cyanotec Ltd products. Cyanotec Ltd specially disclaims all warranties express or implied, including warranties of suitability and suitability for a particular purpose arising from sale or use of Cyanotec Ltd products. Cyanotec Ltd further disclaims any liability for consequential or incremental damages of any kind including lost profits.